

世界最小,螺母外径φ10的超细设计。
可将夹具、工件的干涉控制在最小的高速刀柄。

●可对应极小径立铣刀加工！

世界首创


两面定位



对应MAX.

50,000min⁻¹


BIG-PLUS®

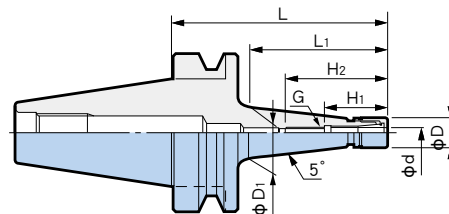

中心贯通。



● 型号说明

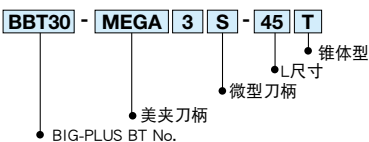

[高刚性锥体型]



BIG-PLUS (BBT 基础柄) 在 BIG-PLUS 主轴和既有的 BT 主轴上均可使用。

BIG-PLUS BBT基础柄型号	夹持直径 φd	φD	φD ₁	L	L ₁	H ₁	H ₂	G	对应夹套	质量 (kg)
BBT30-MEGA3S- 45T	0.45 ~ 3.25	10	11.5	45	20	22	38	M4 P0.7	NBC3S- □	0.42
- 75T			16	75	48					0.45
- 90T			18.5	90	63					0.48
-105T			21	105	78					0.52
-MEGA4S- 60T	0.45 ~ 4.05	12	15	60	33	26.5	47	M5 P0.8	NBC4S- □	0.45
- 75T			17.5	75	48					0.47
- 90T			20	90	63					0.50
-105T			23	105	78					0.54
-120T			25.5	120	93				0.60	
-MEGA6S- 60T	0.45 ~ 6.05	14	16.5	60	33	28.5	49	M7 P0.75	NBC6S- □	0.45
- 75T			19	75	48					0.47
- 90T			22	90	63					0.51
-105T			24.5	105	78					0.56
-120T			27	120	93				0.62	
-MEGA8S- 75T	2.95 ~ 8.05	18	23	75	48	31	50.5	M9 P0.75	NBC8S- □	0.51
-105T			28	105	78					0.62
BBT40-MEGA3S- 60T	0.45 ~ 3.25	10	12.5	60	28	22	38	M4 P0.7	NBC3S- □	1.0
- 90T			17.5	90	58					1.1
-120T			23	120	88					1.2
-MEGA4S- 60T	0.45 ~ 4.05	12	14	60	28	26.5	47	M5 P0.8	NBC4S- □	1.0
- 75T			16.5	75	43					1.1
- 90T			19.5	90	58					1.1
-105T			22	105	73					1.1
-120T			24.5	120	88					1.2
-135T			27	135	103				1.2	
-MEGA6S- 60T	0.45 ~ 6.05	14	15.5	60	28	28.5	49	M7 P0.75	NBC6S- □	1.1
- 75T			18	75	43					1.1
- 90T			21	90	58					1.1
-105T			23.5	105	73					1.1
-120T			26	120	88					1.2
-135T			29	135	103				1.3	
-MEGA8S- 90T	2.95 ~ 8.05	18	24.5	90	58	31	50.5	M9 P0.75	NBC8S- □	1.2
-120T			30	120	88					1.2

1. 附带螺母。夹套、扳手请另行订购。
2. 质量包含螺母，不含夹套。
3. 请注意：使用时的转速受机床刚性和刀具平衡性的影响较大。因此，请将机床转速从低速开始，缓慢调整至合适的转速。



● 型号说明

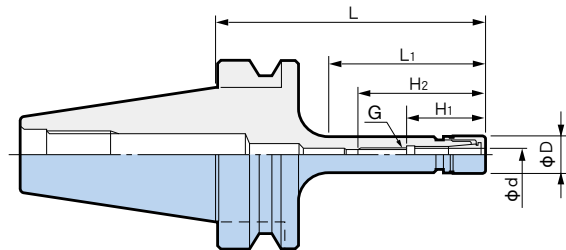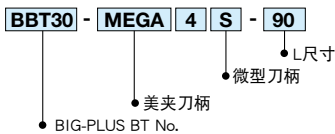

中心贯通。

[直柄型]

BIG-PLUS (BBT 基础柄) 在 BIG-PLUS 主轴和既有的 BT 主轴上均可使用。

BIG-PLUS BBT基础柄型号	夹持直径 φd	φD	L	L ₁	H ₁	H ₂	G	对应夹套	质量 (kg)
BBT30-MEGA4S- 90	0.45 ~ 4.05	12	90	62	26.5	47	M5 P0.8	NBC4S- □	0.46
-MEGA6S- 60	0.45 ~ 6.05	14	60	32	28.5	49	M7 P0.75	NBC6S- □	0.45
- 90			90	62					0.47
-105			105	73					0.49
-MEGA8S- 90	2.95 ~ 8.05	18	90	60	31	50.5	M9 P0.75	NBC8S- □	0.51
BBT40-MEGA4S- 90	0.45 ~ 4.05	12	90	53	26.5	47	M5 P0.8	NBC4S- □	1.0
-MEGA6S- 90	0.45 ~ 6.05	14	90	53	28.5	49	M7 P0.75	NBC6S- □	1.0
-MEGA8S- 90	2.95 ~ 8.05	18	90	55	31	50.5	M9 P0.75	NBC8S- □	1.1

1. 附带螺母。夹套、扳手请另行订购。
2. 质量包含螺母，不含夹套。
3. 请注意：使用时的转速受机床刚性和刀具平衡性的影响较大。因此，请将机床转速从低速开始，缓慢调整至合适的转速。

附件	配件				
美夹螺母 如需购买备用品 F3	美夹扳手 F18	美夹微型夹套 F2	美夹微型油封螺母 (6S、8S 用) F3	夹套箱 F3	α 锥孔清洁棒 F3